

A. BATCHING COLLATED (GLUED) FIBRES:

- □ COLLATED FIBRES SHOULD BE ADDED: -
 - EITHER WITH THE AGGREGATES
 - OR FROM THE SLUMP STAND (OR OTHER SUITABLE LOCATION) **AFTER** ALL OTHER MIX COMPONENTS HAVE ALREADY BEEN BATCHED.
- □ IF ADDED WITH THE AGGREGATES THERE ARE NO FURTHER REQUIREMENTS.
- □ IF ADDED AFTER BATCHING: -
 - 1. HAVE THE TRUCK AT MIXING SPEED (i.e. > 12RPM) DURING ADDITION.
 - 2. OPEN THE BAGS AND ADD THE FIBRE. IF UNOPENED BAGS ARE ADDED DO SO AT THE RATE OF ONE BAG EVERY 20 SECONDS.
 - 3. ROTATE THE TRUCK AT MIXING SPEED FOR 3-5 MINUTES OR UNTIL FIBRES ARE WELL DISPERSED.

NEVER ADD COLLATED FIBRES AT THE FRONT OF A LOAD AS THIS IS LIKELY TO CAUSE BALLING.

B. BATCHING LOOSE FIBRES:

- □ ADD FIBRESTEEL AT THE FRONT OF THE LOAD WITH AGGREGATE OR SPREAD ON CONVEYOR DURING AGGREGATE ADDITION.
- □ FIBRES TO BE ADDED WHILST TRUCK AT MIXING SPEED
- □ ROTATE TRUCK FOR 10 MINUTES AFTER BATCHING COMPLETED TO ENSURE DISPERSION.

NEVER ADD LOOSE FIBRES AT THE END OF A LOAD

IF IN DOUBT PLEASE ASK.